

SERVICE BULLETIN

FEBRUARY 1995

PRODUCT RECALL: TIPS™ FUEL CAP

AFFECTED MODELS

All Go-Karts equipped with TIPS™ cap system.

SYMPTOM

The fuel cap develops a leak during operation. Fuel spurts straight up (1 to 2 inches) from center vent hole. The spillage gets worse when temperature increases.

PROBABLE CAUSE

The new style TIPS™ cap is design to prevent spillage if kart is turned upside down. It does this job very well, but when operated under normal conditions, fuel is forced into cap from movement of kart around track. When fuel gets inside cap, fuel stays in and the only place for it to go is out



CORRECTIVE ACTION

Replace TIPS™ cap with old version type fuel cap.
Return defective caps when you receive new ones.

TIPS™: **Part#01080**

Old Style Kelch Cap: **Part#01081**

Replacement fuel caps will be sent at no charge.

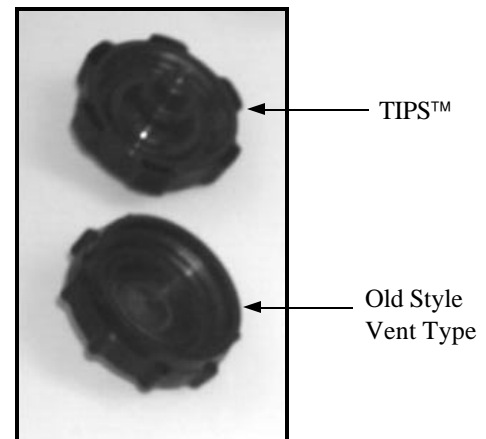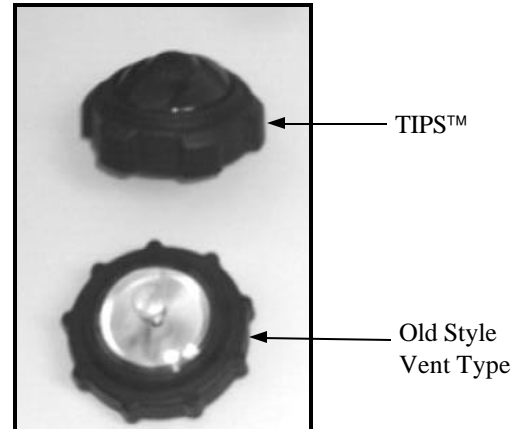

Call (800) 854-3140 or (503) 363-7533 to order replacement caps.



2315 Pringle Road SE
Salem, Oregon 97302
(800) 854-3140
FAX (503) 363-7885



Inside: Go-Kart Fuel Cap Parts Service Bulletin..