


SERVICE BULLETIN

AUGUST 95

KART-0006

FLY BY WIRE (KART REMOTE SYSTEM)

SOME CUSTOMERS ARE REPORTING THAT THE SPEED ADJUSTMENT CAN BE SOMEWHAT ERRATIC. THIS IS CAUSED BY THE ENCODER PUTTING OUT TOO MANY PULSES. IT IS ONLY NOTICEABLE ON A FEW KARTS, BUT CAN BE SOLVED BY PUTTING A 47 ohm 1/4 w RESISTOR ACROSS THE ENCODER. RESISTORS WILL BE INCLUDED WITH THIS

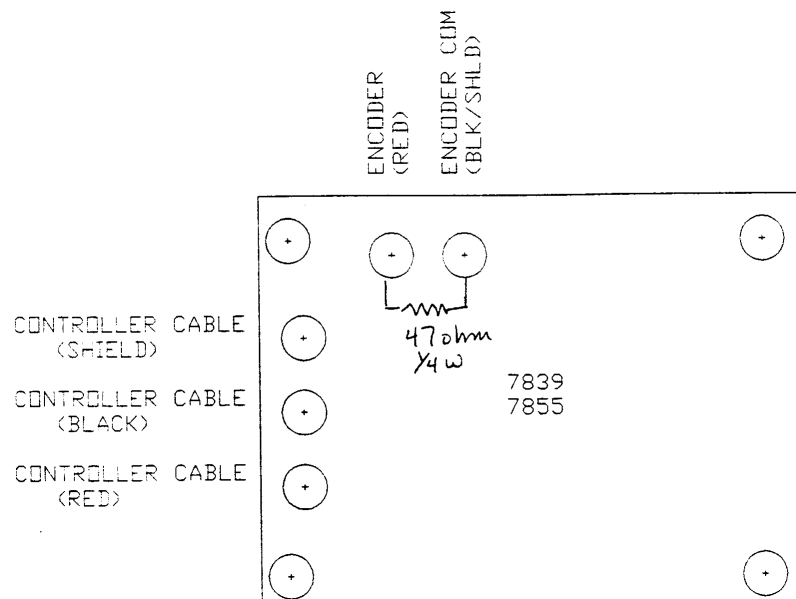

If you have any questions please call service at (800) 854-3140 or (503) 363-